

Product Type	XLR D`i [
Product Model	G7 < A) !6	
Customer Name		

Mars ford and	Prepared	Checked	Approved
Manufacturer			

0	Received	Checked	Confirmed
Customer			

Distributor:

Phone: 407-857-8770 Fax: 407-857-8771 Email: sales@techni-lux.com

www.techni-lux.com





Product Type	XLR Plug	
Product Model	SCHM5-B	

Product Features

- 5-core XLR male plug with black plated stainless steel housing and gold plated contacts
- > Hard, durable, long lifetime and high reliability.
- > Brand new appearance design, smoother operation
- New grounding which provides good total contact between chassis and cable connectors
- > Exquisite groove design on the boot for colored ring for coding and identification
- Resistant to drop and pressure which can still operate stably under harsh conditions
- The boot is equipped with polyurethane sealing sleeve to prevent the cable from being affected by bending pressure to the greatest extent



Product Parameters

Item	Specification
Connection type	XLR
Gender	Male

Electrical Parameters

Item	Specification
Capacitance between contacts	≤ 7 pF
Contact resistance	≤ 3 mΩ
Dielectric strength	1.5 kV DC
Insulation resistance	> 10 GΩ (initial)
Rated current per contact	7.5 A
Rated voltage	< 50 V



Mechanical Parameters

Item	Specification
Cable OD	3.5-8.5mm
Insertion force	≤ 20 N
Withdrawal force	≤ 20 N
Service life	> 5000 mating cycles
Cable size	Max. 1 mm ² Max. 18 AWG
Locking device	Latch lock



Material and Environmental Parameters


Item	Specification
Boot	PA, TPE
Contacts	Cu alloy
Contact plating	Au
Insert	PA
Housing	Stainless steel
Housing plating	Black plating
Strain relief	РОМ
Flame-retardant grade	UL 94 HB
Protection class	IP40
Temperature range	-30°C ~ +80°C

Standards and Certifications

Standards	IEC 61076-2-103
Solderability	Complies with IEC 68-2-20



Product Drawing

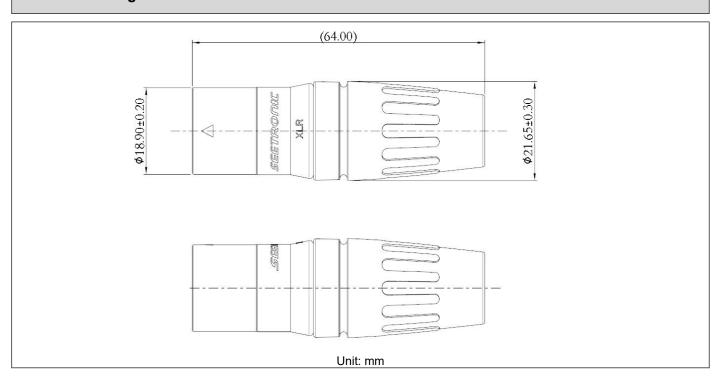

Packaging Method

1 pc per bag (include 1 pc each of inner core, housing, cable clamp, boot)
80 pcs per inner carton, 5 inner cartons per master carton (400 pcs per master carton)

Accessory

✓ No accessories
 ☐ Screws and Nuts
 ☐ Other



Assembly Instructions

(1) Put the cable through the boot	
(2) Strip the cable in the size as shown	4.00
(3) Insert the conductor of the cable into the terminal of the inner core and solder	
(4) Snap the clamp into the soldered cable	
(5) Insert cable into the clamp and clip into the inner core bayonet	



(6) Push the inner core component and clamp into the housing. The two protruding ribs of the inner core component should correspond to the two grooves inside the housing. (7) After assembly of the clamp, inner core component and housing, tighten the boot in a clockwise direction